


## REPAIR OF WATERLINE ON TAILGATE

---

# AVANTIME




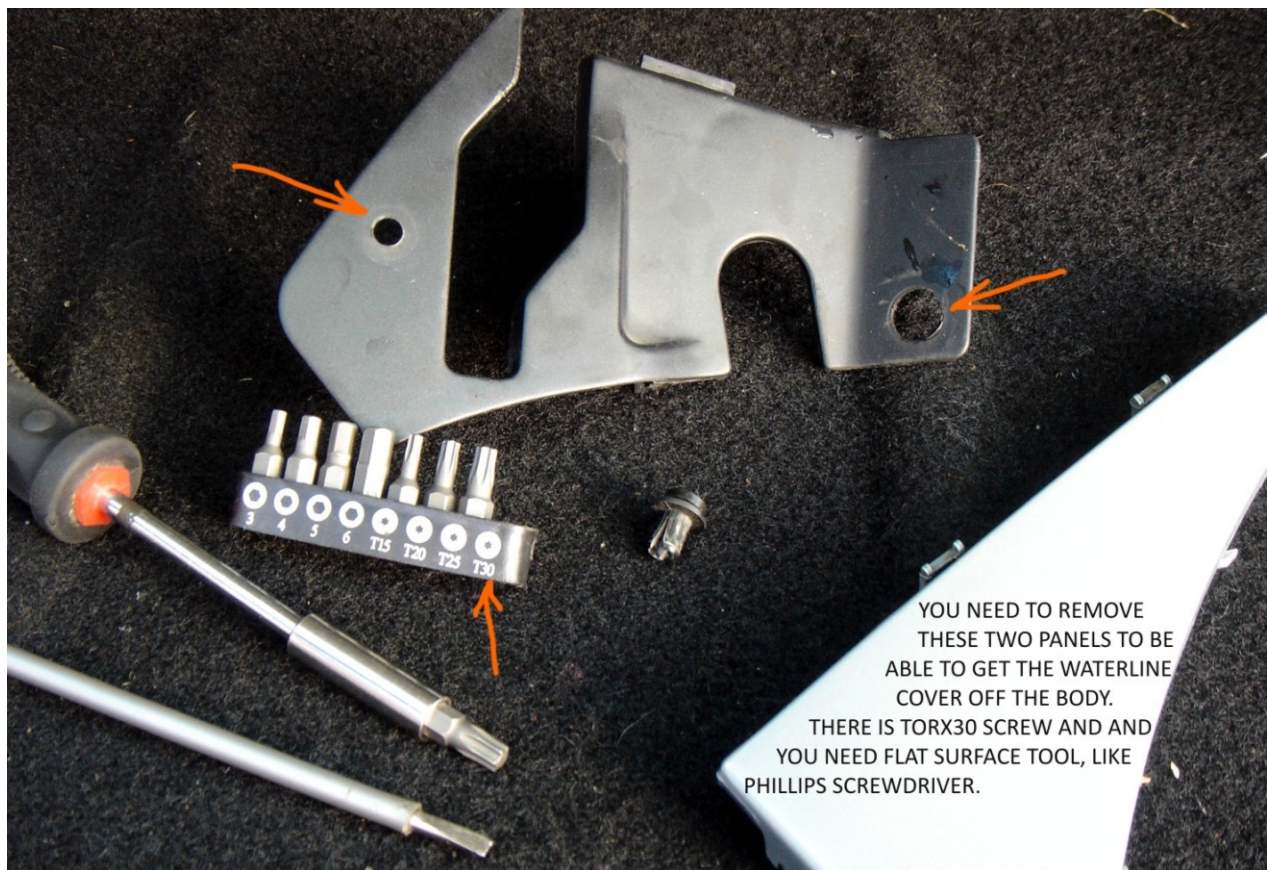





AND TWO CLIPS ARE ON THE BACK END

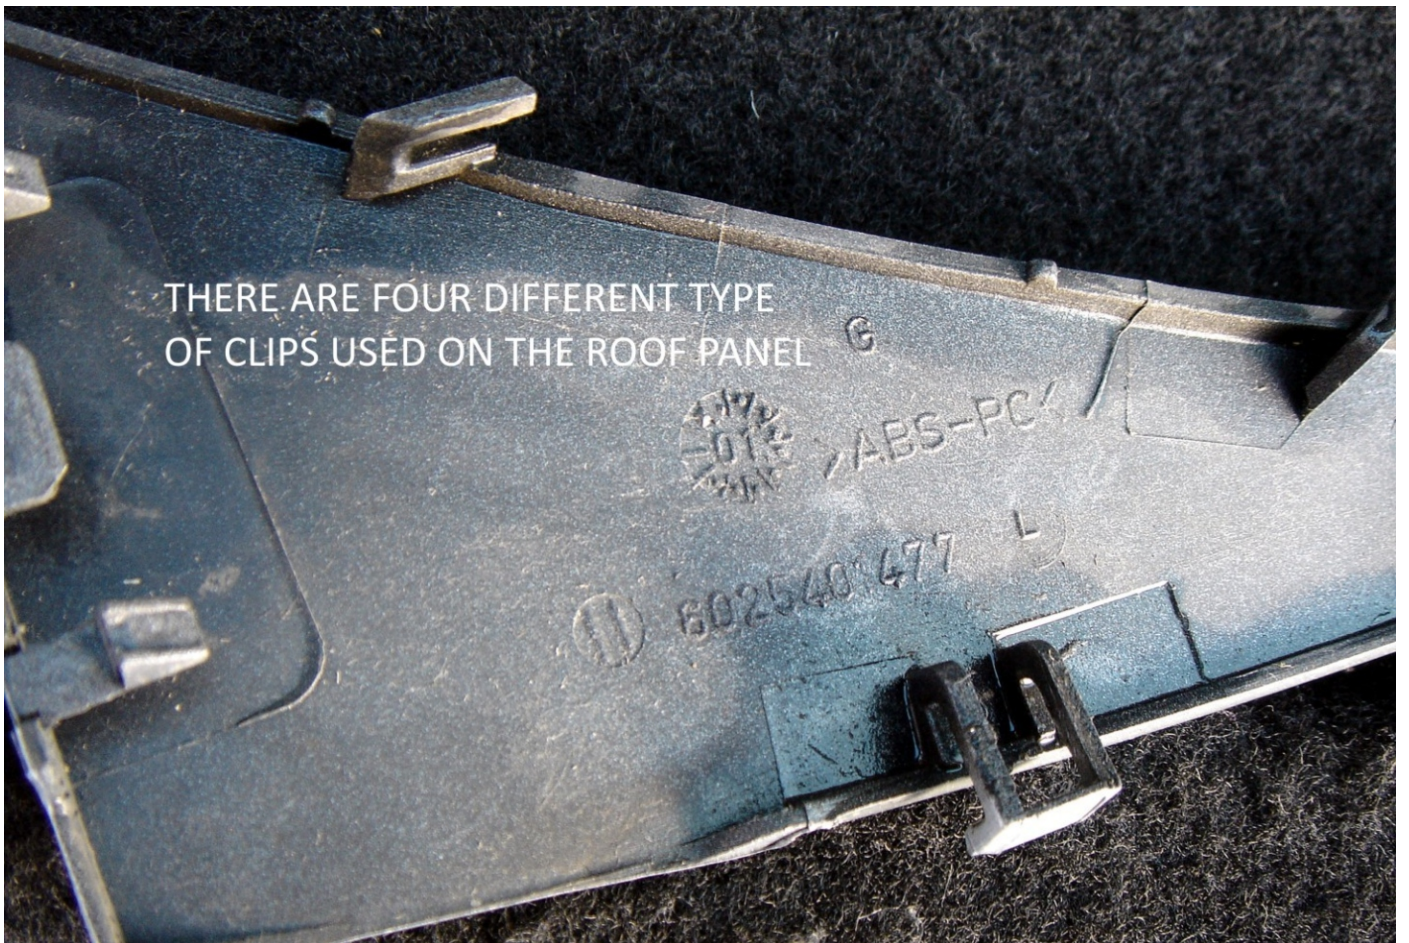


THERE ARE FOUR DIFFERENT TYPE  
OF CLIPS USED ON THE ROOF PANEL





THESE TWO PANELS ARE JOINED BY  
THESE TWO CLIPS, TRY NOT TO BRAKE THEM

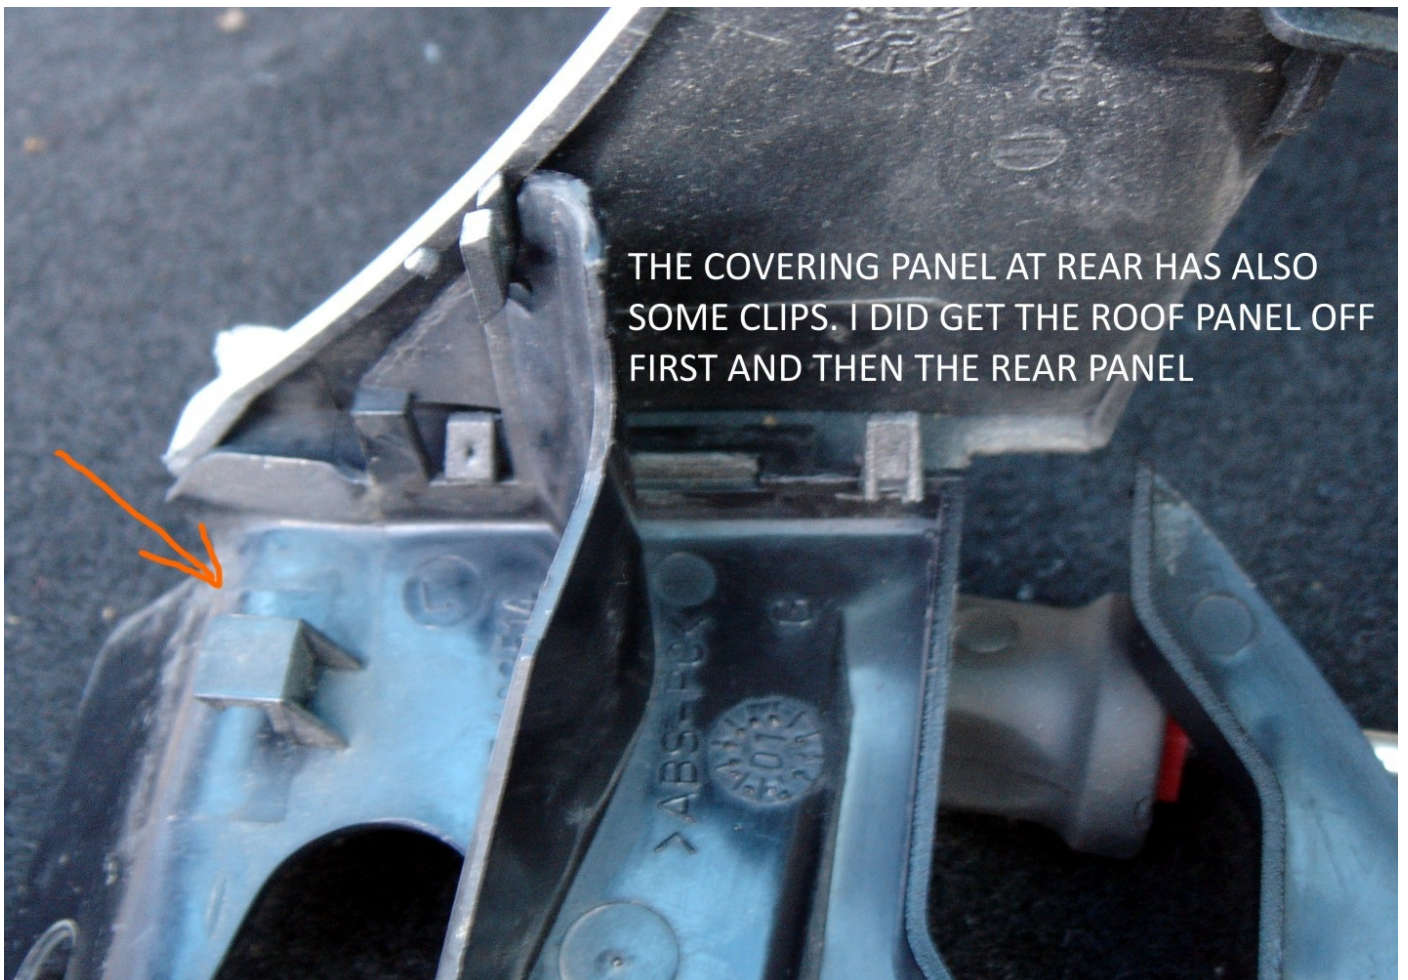


THE COVERING PANEL AT REAR HAS ALSO  
SOME CLIPS. I DID GET THE ROOF PANEL OFF  
FIRST AND THEN THE REAR PANEL






GET THE PROTECTING COVER  
OFF THE TAILGATE AND...




...FROM THE BODY



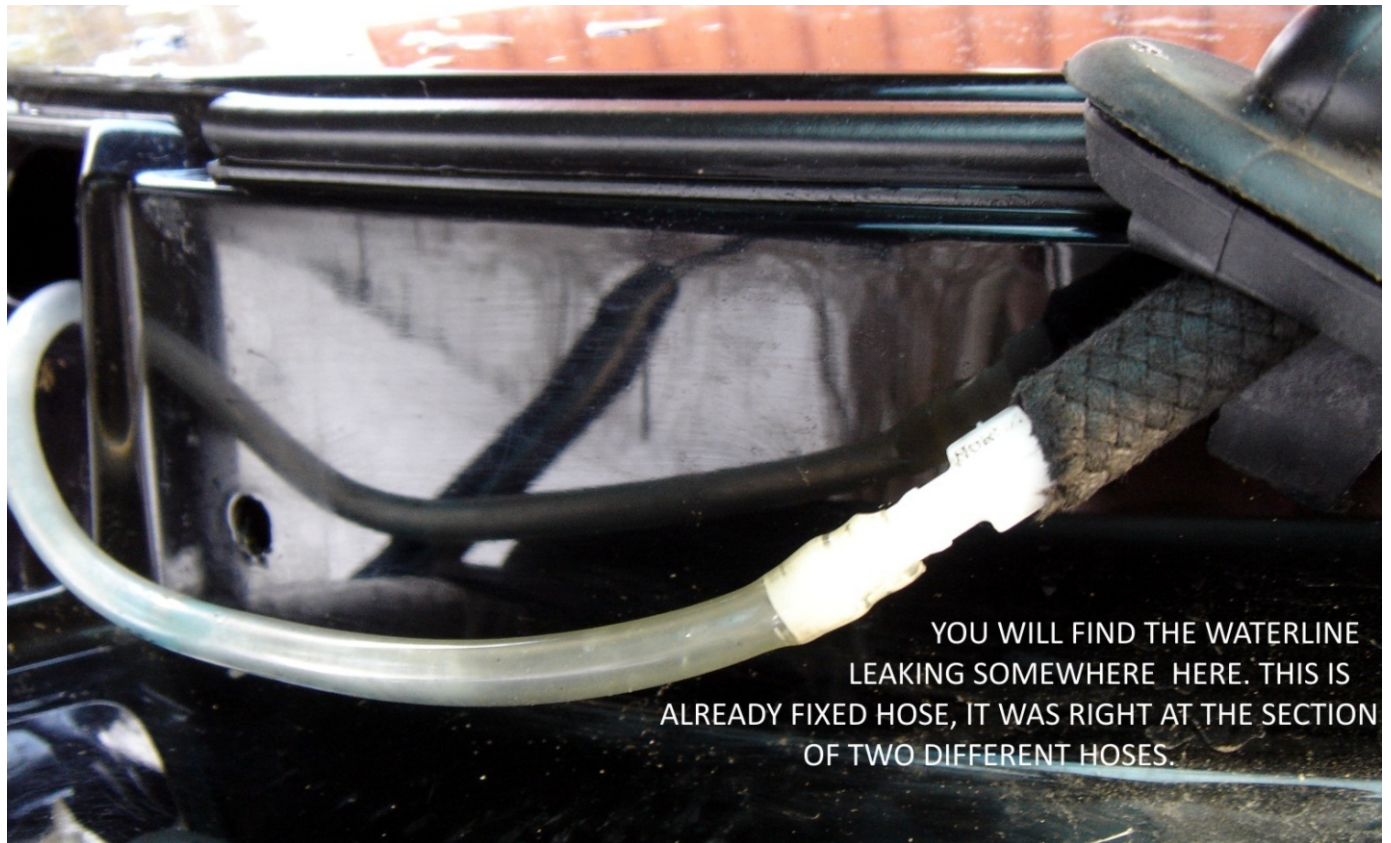

YOU WILL FIND THE WATERLINE  
LEAKING SOMEWHERE HERE. THIS IS  
ALREADY FIXED HOSE, IT WAS RIGHT AT THE SECTION  
OF TWO DIFFERENT HOSES.

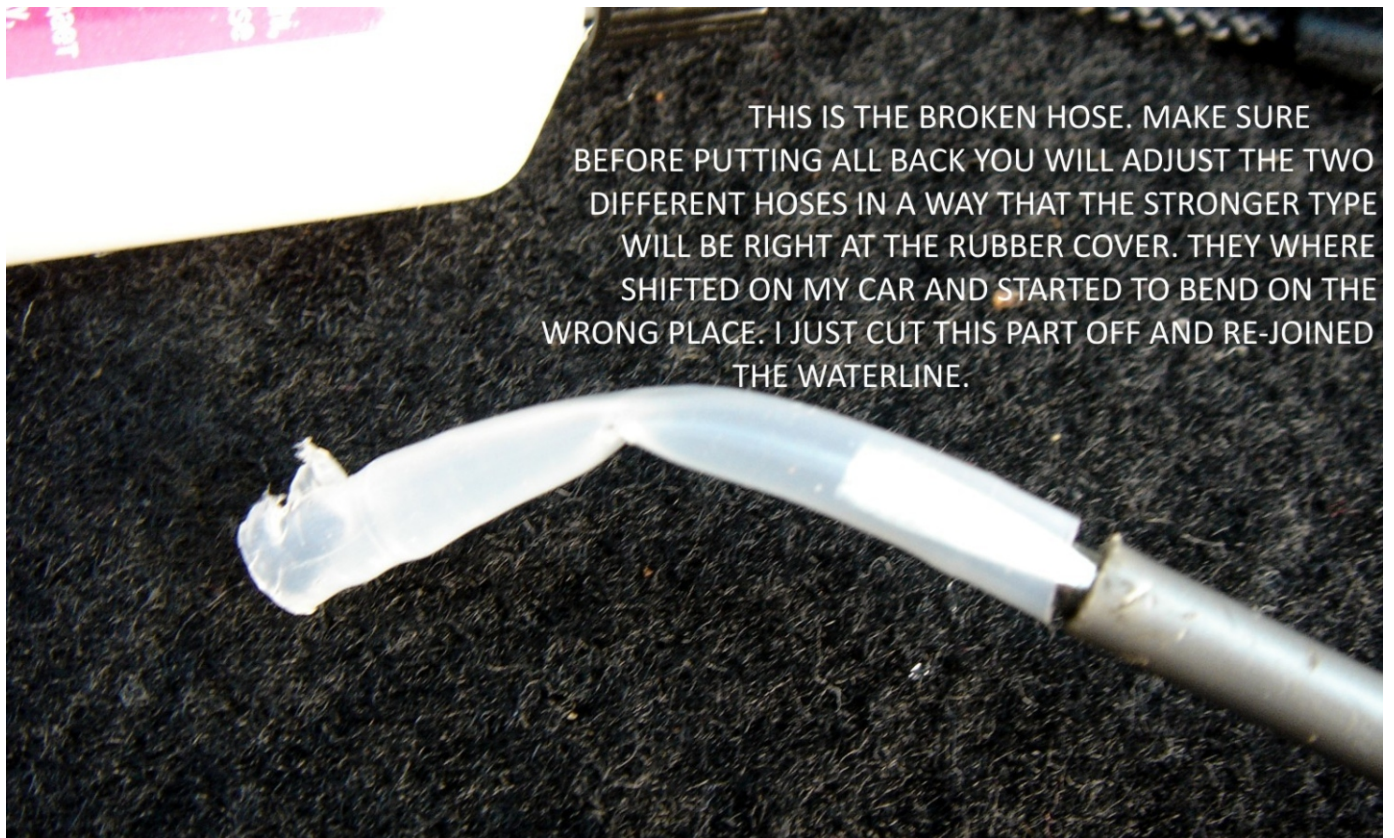

THIS IS THE BROKEN HOSE. MAKE SURE  
BEFORE PUTTING ALL BACK YOU WILL ADJUST THE TWO  
DIFFERENT HOSES IN A WAY THAT THE STRONGER TYPE  
WILL BE RIGHT AT THE RUBBER COVER. THEY WERE  
SHIFTED ON MY CAR AND STARTED TO BEND ON THE  
WRONG PLACE. I JUST CUT THIS PART OFF AND RE-JOINED  
THE WATERLINE.



USE SOME GREASE OR OIL TO HELP IT GETTING BACK

